



Comprehensive Car Inspection Report



Thorough inspection with
300+ quality checks



Precise insights from
experienced technicians



Trusted by
over 600,000 customers



 IND ** ** *****

Hyundai Verna

SX1.5VTVT IVT | 2020 | AT | Petrol

Inspection location: Gurgaon

Report generated on: 24 Apr, 2024



10M +
Cars
Inspected

200 +
Cities
present

1M+
Cars
sold

Content of report

01 Your report at a glance

Overview of your overall car condition




02 Inspection summary

Category wise ratings and condition



03 Detailed Evaluation of each category

1. Exterior & Tyres
2. Engine & Transmission
3. Steering, Suspension & Brakes
4. Air Conditioning
5. Electricals & Interiors
6. Other Details

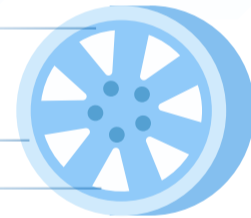

04 Past service records

Detailed history of maintenance, repairs, odometer tampering and accident reports



05 OEM installed features & specs

1. Safety
2. Fuel & Performance
3. Entertainment & Communication
4. Dimensions & Capacity
5. Engine, Transmission & Brakes
6. Comfort & Convenience





Hyundai Verna

SX 1.5 VTVT IVT | 2021 | Automatic | Petrol

Overall Rating **4.2/5** **Excellent**


 Odometer reading
72,553 kms


 Estimated Value
₹9.5 L - ₹10.5 L

 **4 Challans Pending**

[Check challans >>](#)

 Ownership no.
02

 Blacklisted
false

 Fitness validity
06 Jul, 2036

Health report summary

At CARS24, we inspect cars thoroughly across 140 parameters, ensuring the highest quality. Your car has been inspected and is non-accidental, non-flooded, and non-tampered.

- The car's engine and transmission are in good working condition.
- The exterior has minor scratches and dents, but no major damage.
- The interior is in good condition with minor wear and tear.

Overall, your car is in good condition with minor cosmetic issues.

Ownership and fitness *CARS24 refund guarantee applicable*

Owner: **Ray Kumar Singh**

Registration date: **30 June, 2014**

Ownership number: **1**

Registration place: **Noida, Uttar Pradesh**

Ownership type: **Individual**

Fitness validity: **6 Jul, 2036**

Estimated kms/year: **6,666 kms**

PUCV validity: **31 March, 2024**

Transferability details

Blacklisted: **No**

RTO NOC Issued: **30 June, 2014**

Party Peshi Applicability: **No**

Hypothecation & **Yes &**
Financier Name: **HDFC Bank Pvt. Ltd.**


Vehicle modification


Converted (Commercial ownership to private): **No**

Migration (Re-registered in another state): **No**

Adapted for Special Use (Example differently abled): **No**

Legal history details

Criminal cases: **1** 

Civil cases: **1** 

Road accidents: **None reported**

Theft cases: **None reported**

Compensation cases: **None reported**

Other cases: **None reported**

Criminal case

Accident date: 16 June, 2023

Filing date: 15 June, 2023

Place: New Delhi, Delhi

Violation: Minor Traffic Violation

Legal position: Accused

FIR number: FIR123/2023

FIR summary: Signal jumping incident

Acts/Sections: IPC, Section 279

Civil case: Disposed

Filing date: 1 July, 2023

Disposed date: 1 December, 2023

Place: New Delhi, Delhi

Violation: Contract dispute

Legal position: Respondent

CNR number: CNR123/2023

Disposal summary: Settled by mutual agreement

Order judgement summary: Case disposed with mutual settlement

Challan history

⚠ Total 4 pending challans worth ₹7,000

[Pay now >](#)

2025

i Total challans: 2

⚠ Pending: 2

Date	Offence	Challan no.	Amount	Status
12 Jan, 2025	OVER SPEED (Light Motor Vehicle) (112/183 MV ACT)+2 more	1234567890	₹2,000	Pending
12 Jan, 2025	Improper parking	1234567890	₹1,000	Pending

2023

i Total challans: 1

Date	Offence	Challan no.	Amount	Status
12 Jan, 2023	Improper parking	1234567890	₹500	Paid

2014

i Total challans: 4

⚠ Pending: 2

Date	Offence	Challan no.	Amount	Status
12 Jan, 2014	OVER SPEED (Light Motor Vehicle) (112/183 MV ACT) +2 more	1234567890	₹2,000	Moved to physical court
12 Jan, 2014	Improper parking	1234567890	₹500	Paid
12 Jan, 2014	Improper parking	1234567890	₹500	Moved to physical court
12 Jan, 2014	Improper parking	1234567890	₹500	Paid

Inspection summary

This section provides a comprehensive evaluation of the most recent car assessment, meticulously divided into five key categories to offer an in-depth and accurate overview.

Exterior & Tyres

The exterior of the car has scratches and some parts have been repainted. The tyres have a tread depth of 3-5mm.

3.7/5

Neutral

Engine & Transmission

The engine is in good condition. There are no issues with blow-by, engine sound, or exhaust smoke. However, the engine oil is dirty.

4.5/5

Excellent

Steering, Suspension & Brakes

Your car's steering, suspension, and brakes are all in good condition. There are no issues that need immediate attention.

4.5/5

Excellent

Air Conditioning

The air conditioning in your car is working perfectly. The AC, heater, and climate control are all functional.

4.7/5

Excellent

Electricals & Interiors

Your car has all the electrical features working well, including power windows, airbags, music system, and a reverse camera. The interior is in good condition with leather seats and a sunroof.

4.4/5

Excellent

Vehicle images



Exterior & Tyres

Engine & Transmission

Electricals & Interiors

Steering, Suspension & Brakes

Air Condition

Other Details

01. Exterior & Tyres

Perfect parts: 26 | Imperfect parts: 25 | Estimated repair cost: ₹10,000



Parameters	Perfect	Imperfect
Boot Floor	✓	
Pillar LHS A	✓	
Pillar LHS B	✓	
Pillar LHS C	✓	
Pillar RHS A	✓	
Pillar RHS B	✓	
Pillar RHS C	✓	
Apron LHS	✓	
Apron RHS	✓	
Apron RHS LEG	✓	
Apron LHS LEG	✓	
Firewall	✓	
Cowl Top	✓	
Upper Cross Member (Bonnet Patti)	✓	
Front Show	✓	
Lower Cross Member	✓	
Radiator Support	✓	

Exterior & Tyres

Engine & Transmission

Electricals & Interiors

Steering, Suspension & Brakes

Air Condition

Other Details

Parameters	Perfect	Imperfect
Head Light Support	✓	
Windshield Rear	✓	
Light LHS Taillight	✓	
Light LHS Fog Light	✓	
Light RHS Fog Light	✓	
ORVM - Manual / Electrical LHS	✓	
Tyre Spare Tyre	✓	
Grill	✓	
Is the Car Waterlogged?	✓	
Roof		!
Bonnet/Hood		!
Dicky Door / Boot Door		!
Quarter Panel LHS		!
Quarter Panel RHS		!
Fender LHS		!
Fender RHS		!
Running Border LHS		!
Running Border RHS		!
Door LHS Front		!

Exterior & Tyres

Engine & Transmission

Electricals & Interiors

Steering, Suspension & Brakes

Air Condition

Other Details

Parameters	Perfect	Imperfect
Door LHS Rear		!
Door RHS Front		!
Door RHS Rear		!
Windshield Front		!
Light LHS Headlight		!
Light RHS Headlight		!
Light RHS Taillight		!
Bumper Front		!
Bumper Rear		!
ORVM - Manual / Electrical RHS		!
Alloy Wheel		!
LHS Front Tyre		!
LHS Rear Tyre		!
RHS Front Tyre		!
LHS Rear Tyre		!

Exterior & Tyres

Engine & Transmission

Electricals & Interiors

Steering, Suspension & Brakes

Air Condition

Other Details



Roof: No Dents, Scratched



Bonnet/Hood: No Dents, Scratched



Dicky Door / Boot Door: No Dents, Scratched



Quarter Panel LHS: No Dents, Repainted



Quarter Panel RHS: No Dents, Repainted



Fender LHS: No Dents, Scratched, Repainted



Fender RHS: No Dents, Repainted



Running Border LHS: No Dents, Scratched, Repainted

Exterior & Tyres

Engine & Transmission

Electricals & Interiors

Steering, Suspension & Brakes

Air Condition

Other Details



Running Border RHS: No Dents, Repainted



Door LHS Front: No Dents, Scratched, Repainted



Door LHS Rear: No Dents, Repainted, Scratched



Door RHS Front: No Dents, Repainted



Door RHS Rear: No Dents, Repainted



Windshield Front: Scratched

Exterior & Tyres

Engine & Transmission

Electricals & Interiors

Steering, Suspension & Brakes

Air Condition

Other Details



Light LHS Headlight: Scratched



Light RHS Headlight: Scratched



Light RHS Taillight: Scratched



Bumper Front: Scratched, Dented



Bumper Rear: Repainted



ORVM - Manual / Electrical RHS: Damaged



Alloy Wheel: Scratched



LHS Front Tyre:  70% life remaining

Exterior & Tyres

Engine & Transmission

Electricals & Interiors

Steering, Suspension & Brakes

Air Condition

Other Details



LHS Rear Tyre:  30% life remaining



RHS Front Tyre:  70% life remaining








LHS Rear Tyre:  30% life remaining

02. Engine & Transmission

Perfect parts: 11 | Imperfect parts: 01 | Estimated repair cost: ₹500



Parameters	Perfect	Imperfect
Engine		
Engine Sound		
Exhaust Smoke		
Engine Permissible Blow by (Back Compression)		
Clutch		

Exterior & Tyres

Engine & Transmission

Electricals & Interiors

Steering, Suspension & Brakes

Air Condition

Other Details

Parameters	Perfect	Imperfect
Gear Shifting	✓	
Engine Oil Level Dipstik	✓	
Battery	✓	
Coolant	✓	
Sump	✓	
Engine Oil		!

03. Electricals & Interiors

Perfect parts: 14 | Imperfect parts: 00 |



Parameters	Perfect	Imperfect
4 Power Windows	✓	
Airbag Feature	✓	
Music System	✓	
Leather Seat	✓	
Sunroof	✓	
Steering Mounted Audio Control	✓	
ABS	✓	
Rear Defogger	✓	

Exterior & Tyres







Engine & Transmission

Electricals & Interiors

Steering, Suspension & Brakes

Air Condition

Other Details

Parameters	Perfect	Imperfect
Reverse Camera		
Electrical		
Interior		
Parking Sensor		
No. Of Airbags		
No. Of Power Windows		

Parameters	Number
No. Of Airbags	2
No. Of Power Windows	4



04. Steering, suspension & Brakes

Perfect parts: 02 | Imperfect parts: 01 | Estimated repair cost: ₹4,000



Parameters	Perfect	Imperfect
Steering		
Suspension		
Brake		



Exterior & Tyres

Engine & Transmission

Electricals & Interiors

Steering, Suspension & Brakes

Air Condition

Other Details

05. Air Conditioning

Perfect parts: 03 | Imperfect parts: 0



Parameters	Perfect	Imperfect
AC Cooling	✓	
Heater	✓	
Climate Control AC	✓	



06. Other Details

Available : 03 | Not Available: 01



Parameters	Available	Not available
Chassis Embossing	✓	
RC Availability	✓	
Insurance Image	✓	
Duplicate Key		!

Exterior & Tyres

Engine & Transmission

Electricals & Interiors

Steering, Suspension & Brakes

Air Condition

Other Details

Total estimated repair cost



A rough estimate of the cost required to fix identified imperfections in the car, helping you anticipate potential repair expenses before buying/selling.

Total estimated repair cost: ₹14,450

Total imperfect parts:27



Parameters	Total imperfect parts	Est. Repair Cost
Exterior & Tyres	25	₹10,000
Engine & Transmission	1	₹500
Steering, Suspension & Brakes	1	₹4,000



SAMPLE REPORT

Past service records

Viewing the service history from authorised workshops helps assess the car's maintenance, check for any accidents, plan future care, and build confidence in its reliability and boost confidence in ownership.

Last odometer reading
(km at OEM)

1,00,000 Km

Total loss reported

No

Accidental history

Yes

CARS24 refund guarantee applicable

Service and maintenance summary


This vehicle is serviced regularly

This car has been serviced 9 times in 9 years with no service gaps exceeding 23 months

Vehicle Details	Value	Remark
Total services at authorised service centre	9	✓
Last service at authorised service centre	9 Jan, 2025	✓
Structural damage	No	✓
Airbag deployment	No	✓
Flooded car <i>CARS24 refund guarantee applicable</i>	No	✓
Odometer tampering <i>CARS24 refund guarantee applicable</i>	Yes	!
Gear/Transmission repair	No	✓


Odometer reading  *CARS24 refund guarantee applicable*

METHODOLOGY Odometer tampering is identified if the next service record has a lower odometer reading than the previous one.

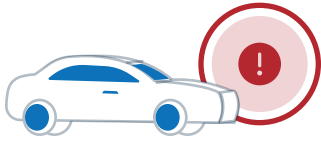


Odometer has been tampered once

The odometer has been tampered 01 time till now before the 7th service of the car. Since the odometer reading went down from S6 to S7.

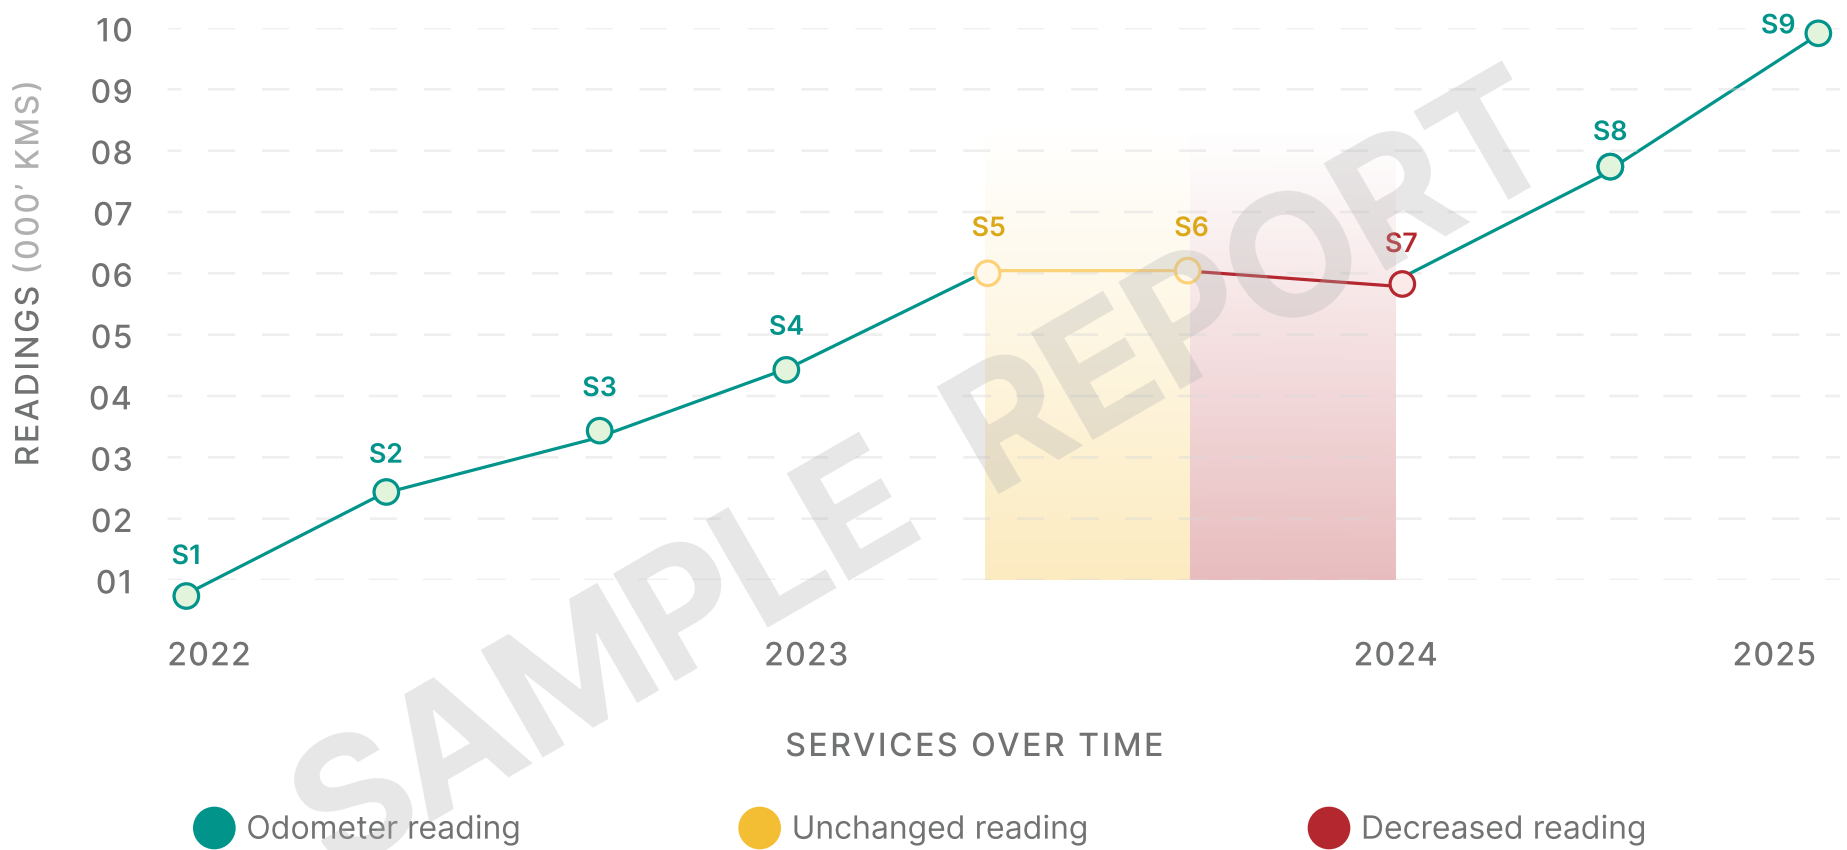

Accident history  *CARS24 refund guarantee applicable*

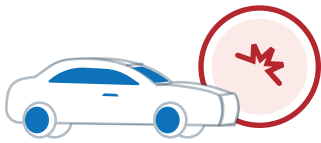

Major and minor accident reported in this car

There have been 6 major and minor accidents reported for this car.

Service records

Service Visit Number	Service Date	Odometer Reading (Kms)	Part Details
S9	Jan 4, 2025	10,000 Km	<p>Service Category: Ac Maintenance, Suspension Maintenance, Light Maintenance, Transmission Maintenance, Engine Maintenance, Regular Service, Wheels,tires</p> <p>Coolant, Shock absorbers, Wheels, Crankshaft, Brake oil, Bearing front strut, Wheel balancing done, Greasing, Shift levers, Screen wash, Greasing, high-temperature grease, Bulbs checked, Wheel alignment done, Plug oil drain work, Inter-cooler, Pump assy oil, Air filter, Stabilizer</p>
S8	May 2, 2024	7,500 Km	<p>Service Category: Brake Maintenance, Regular Service</p> <p>Greasing, Filter elements, Oil filters replaced, Greasing, high-temperature grease, Plug oil drain work, Brake caliper assy, Oil filter</p>
S7	Dec 3, 2022	5,800 Km	<p>Service Category: Suspension Maintenance</p> <p>Suspension checked, Stabilizer</p>
S6	May 18, 2022	6,000 Km	<p>Service Category: Ac Maintenance, Suspension Maintenance, Light Maintenance, Engine Maintenance, Brake Maintenance, Cables, Regular Service, Wheels,tires</p> <p>Greasing, Filter elements, Greasing, high-temperature grease, Radiators checked, Bulbs checked, Suspension checked, Cooling fans, Stabilizer, Brake oil, Inter-cooler, Brake discs checked, Air filter, Coolant, Wheels, Bearing front strut, Bearings, Cables, Brake caliper assy, Oil filter, Wheel bearing</p>
S5	Sep 28, 2021	6,000 Km	<p>Service Category: Light Maintenance, Wheels,tires, Brake Maintenance, Regular Service</p> <p>Washing and cleaning, Warning lights checked, Wheels, Greasing, Engine oil, Wheel balancing done, Greasing, high-temperature grease, Screen wash, Filter elements, Engine oil replaced, Bulbs checked, Wheel alignment done, Plug oil drain work, Brake caliper assy, Oil filter</p>
S4	Nov 13, 2019	4,218 Km	<p>Service Category: Ac Maintenance, Suspension Maintenance, Light Maintenance, Engine Maintenance, Brake Maintenance, Regular Service, Wheels,tires</p> <p>Brake discs checked, Coolant, Wheels, Crankshaft, Brake oil, Engine oil, Wheel balancing done, Greasing, Screen wash,</p>

Service Visit Number	Service Date	Odometer Reading (Kms)	Part Details
			Greasing, high-temperature grease, Bulbs checked, Wheel alignment done, Plug oil drain work, Cooling fans, Stabilizer
S3	Aug 22, 2018	3,812 Km	Service Category: Regular Service General repair
S2	Jul 14, 2018	2,518 Km	Service Category: Ac Maintenance, Steering Maintenance, Suspension Maintenance, Light Maintenance, Engine Maintenance, Exterior Body Work, Wheels,tires Right fender changed, Head lamp checked, Wheels, Tie rods, Head lamp replaced, Bearings, Radiators checked, Signal lamps checked, Front bumper, Worm shaft assy, Signal lamps replaced, Fog lamps checked, Suspension checked, Stabilizer
S1	Nov 27, 2017	1,000 Km	Service Category: Periodic Electrical Maintenance, Ac Maintenance, Light Maintenance, Transmission Maintenance, Engine Maintenance, Regular Service Horns, Coolant, O-rings, Greasing, Brake oil, Greasing, high-temperature grease, Gears, Screen wash, Bulbs checked, Plug oil drain work, Cooling fans

SAMPLE REPORT

☆✓ ☆- **OEM installed features & specs**

Understanding the features and specifications of the **Hyundai Verna** is essential to ensure it aligns with your preferences, needs, and lifestyle, helping you find the perfect automotive match.

Power window
Front & rear

Airbags
04

Seating capacity
05

Safety


Parameters	Metric
Front Fog Lights	Yes
ISOFIX-Child Seat Anchor Points	Yes
Anti-lock Braking System (ABS)	No
Central Locking	Keyless Entry
Rear Defogger	Yes
Airbags	04

Fuel & Performance


Parameters	Metric
Max power (bhp)	81.80
Max torque (Nm)	114.7
Fuel tank capacity (lit)	24
Emission Standard	BSIV

Entertainment & Communication


Instrument panel type	360 degree camera	Speaker brand
Analogue & digital	Yes	JBL

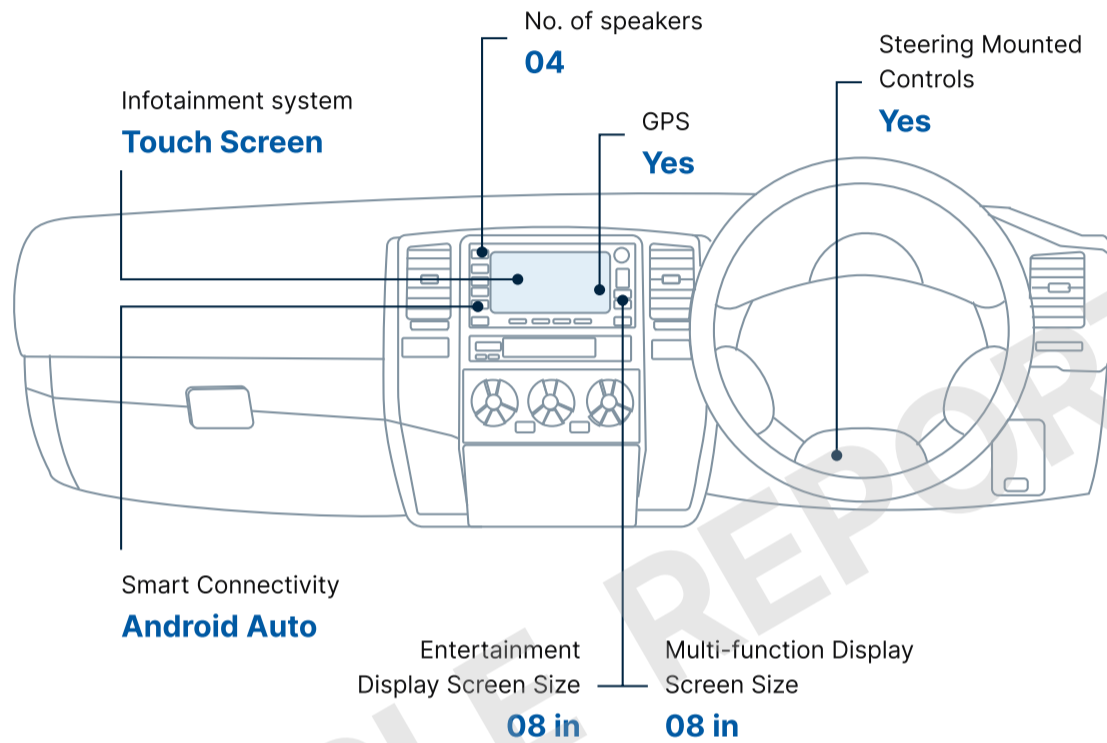

Interior & Exterior

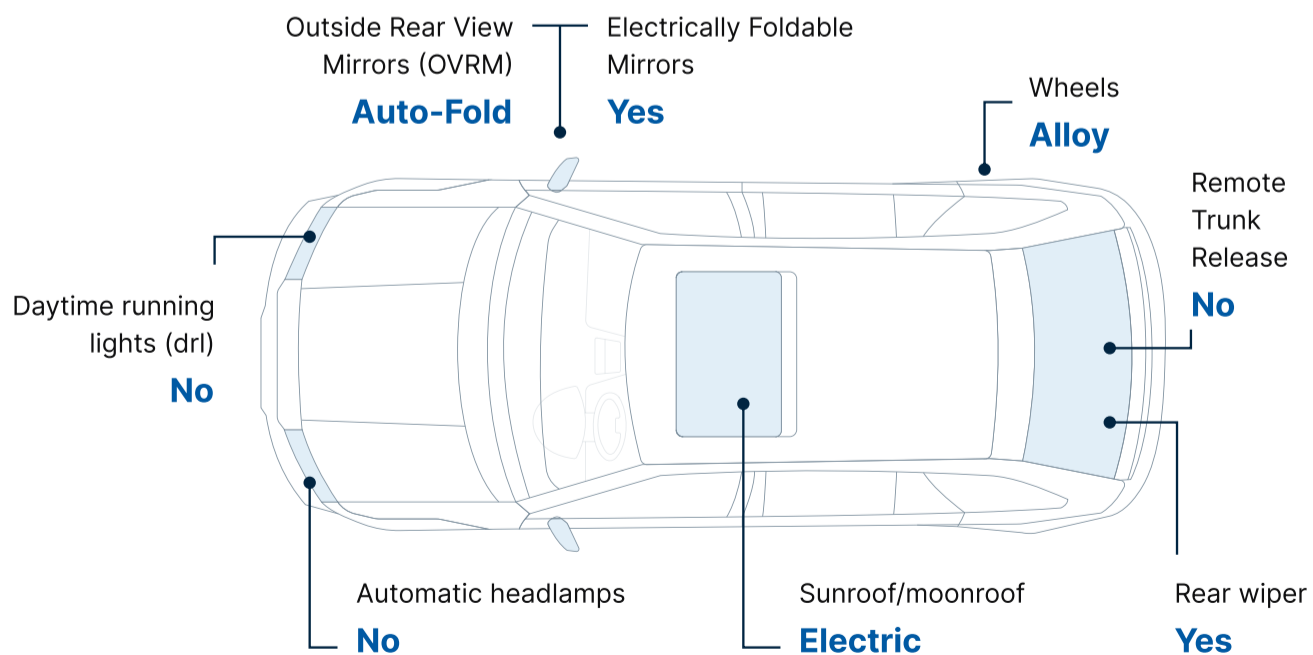

Dimensions & Capacity

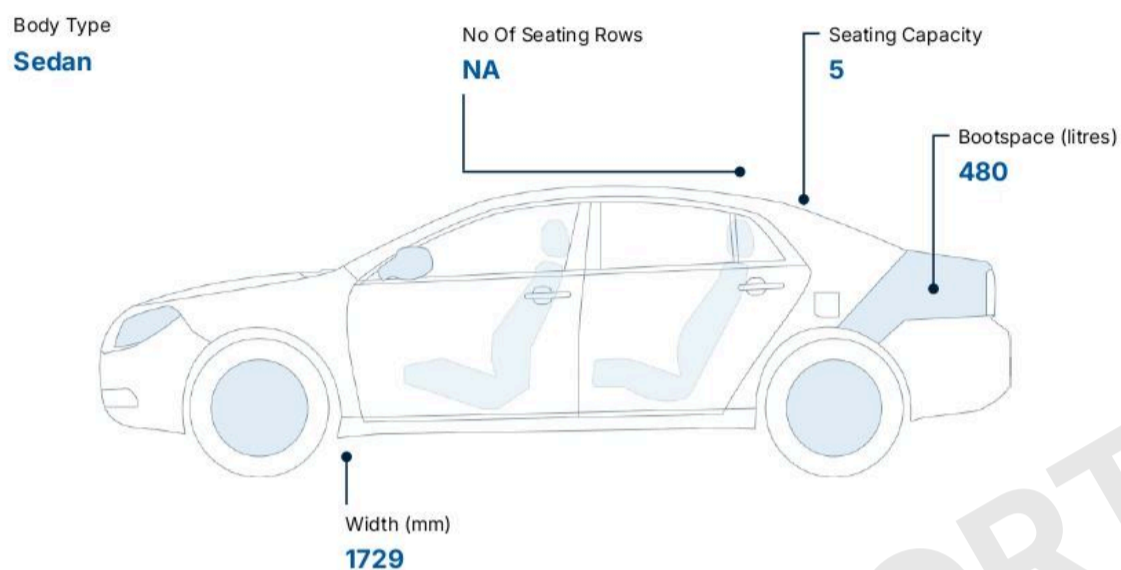


Engine, Transmission & Brakes

Parameters	Metric
Gear Box- No. of Gears	04
Displacement (cc)	1800
Transmission type	Manual
Cylinders	02
Break type (rear)	Drum
Break type (front)	Drum
Number of disc brakes	02


Comfort & Convenience

Parameters	Metric
Seat upholstery (cc)	1800
Auto climate control	Yes
Wireless charging pad	Yes
Steering wheel material	Alloy & Synthetic Leather
Smart Card/Smart Key	Yes
Top model	Yes


Parking sensors

No 


Rear AC

Yes 


Power windows

Front & rear 


Steering adjustment

Tilt & telescope 


Driver seat adjustment

Manual 


Cruise control

No 

Air conditioner

Yes 

Push button start

Yes 

Thank you for choosing us!

We truly appreciate your decision to prioritize the safety and maintenance of your vehicle. By opting for a thorough inspection, you're ensuring not only the longevity of your car but also peace of mind for you and your loved ones.

Should you have any questions about the inspection report or need further assistance, please don't hesitate to reach out. We're here to help and ensure your vehicle remains in top condition.


Thank you once again for your trust and patronage.

Other services by

[CHALLAN](#) ↗

[SERVICE HISTORY](#) ↗

[PERSONAL LOAN](#) ↗

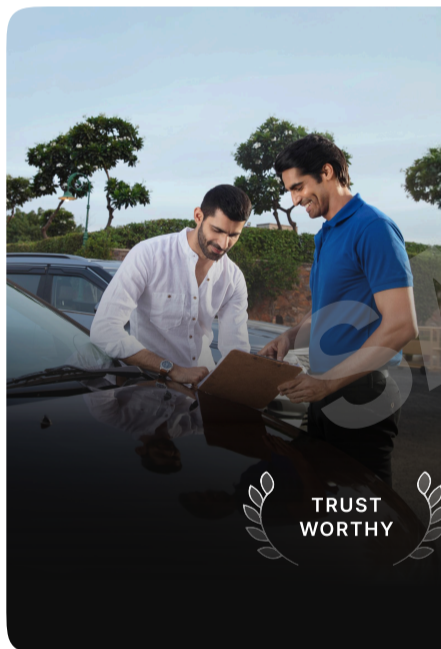

Buying, selling, and financing pre-owned cars is now easier than ever!

4.3 ★★★★★
194K ratings • 


4.5 ★★★★★
24.1K ratings • 

4.1 ★★★★★
1K ratings • 

Experience CARS24 App on mobile



Keep in touch

 care@cars24.com

